



50mV and 100mV Base-mounted DC Shunts

Murata Power Solutions' 50mV and 100mV base-mounted current shunts are designed for measuring dc currents from 5A to 1200A. These precision shunts (+/-0.25% accuracy) connect directly to MPS's DCA5-20PC Series of dc ammeters. Installation is straightforward: simply connect the load circuit to the shunt's threaded studs and the shunt's mV Kelvinoutputs to the digital ammeter's input terminals.

All models feature a rugged phenolic base that provides 750V isolation to the shunt's brass terminals, allowing for direct attachment to metal surfaces. A highly stable (+/-15ppm/°C) manganin sensing-element provides a wide -40 to +60°C operating temperature range. Please see the DCA5-20PC data sheet for additional ammeter-related information and detailed connection diagrams.

General Specifications (All Models)			
Rated Accuracy	±0.25% max.		
Sensing Element	Manganin		
Terminal Posts/Screws	Brass		
Tightening Torgue	See Mechanical Dimensions		
Current Rating	See Selection Guide		
Operating Temperature	-40 to + 60°C (-40 to +137°F)		

Technical Notes

IMPORTANT! To ensure safe and reliable operation, dc shunts and all associated equipment must be installed and serviced by qualified technical personnel. Never make any connections to the shunt, the load, or the ammeter with energized power sources. Contact Murata Power Solutions if you have any questions regarding the installation or operation of any of our instruments and accessories.

1. Base-Mounted Shunt Precautions: DC current shunts are low value resistors that develop a mV output when current passes through their highly-stable manganin resistive element. Under high current, continuous use operation, dc shunts will dissipate considerable power and may undergo a significant temperature rise. For example, if allowed to operate continuously at its full rated load, a 500A/50mV shunt dissipates 25 Watts (500A x 0.050V = 25 Watts). Therefore, whenever possible, be sure to specify 50mV shunts due to their inherently lower power dissipation and voltage drop.



To ensure that the manganin sensing element does not exceed 125°C under worst case operating conditions, please read and follow the guidelines in the mounting and derating sections of this data sheet. Tighten all connections on the shunt per the torque specifications given in the mechanical dimensions and selection guide on page 3. Please note, the user is responsible for selecting the correct wire sizes (gauge) and wire type for the given application.

2. Mounting Considerations: All shunts should be mounted with their resistance blades in a vertical position to allow for natural convection cooling (see Figure 1). Forced-air cooling must be provided when vertical mounting is impractical, or in installations where the shunt is installed in a confined location. The shunt's manganin blades must never be allowed to exceed +125°C; doing so will cause permanent damage to the shunt.

Shunts must be installed in a manner that protects them from damage due to thermal expansion forces produced by high- or short-circuit currents. In most cases, shunts are weaker than their external-circuit connections, so provisions for additional wiring-flexibility may be required in high current and/or high-vibration applications.

Whenever practical, all shunts should be connected in the grounded side (normally the 'chassis') of the dc supply. However, these shunts must be connected in the grounded side of the circuit when the dc supply exceeds 750 volts (the rated limit for the shunt's phenolic insulating base). When more than one wire is to be connected to each end of a shunt, the wires must be evenly distributed between both terminals (see Figure 1).

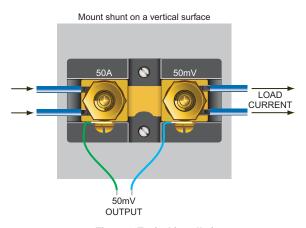


Figure 1. Typical installation







DMS Accessories

50mV and 100mV Base-mounted DC Shunts

- 3. Lead Extensions: The shunt's Kelvin outputs (i.e., their 50mV or 100mV output signal) should not exceed 24 inches in length (61cm), assuming 22AWG (0.5mm2) wire is used. If longer leads are necessary, the additional voltage drops in the leads must be taken into consideration as they will degrade accuracy and stability. However, MPS's DCA5 series dc ammeters feature a calibration potentiometer that can be used to compensate for some additional losses when long leads are employed; contact MPS for calibration information.
- 4. Continuous-Operation Derating: If continuous operation is required, a shunt must only be allowed to carry 2/3 of its maximum nameplate amperage. The 2/3 derating factor provides an adequate safety margin for convection cooled shunts operating in an ambient temperature of +25°C. The following two sections contain additional derating that is required when shunts will be exposed to higher operating temperatures or pulsed (intermittent) currents.
- **5. Temperature Derating:** If the shunt is to be operated at ambient temperatures above +25°C, the maximum continuous current must be further derated from the 2/3 value previously noted.

To find the maximum permissible continuous current (le) at an elevated temperature (Te), one must first calculate the maximum allowable power dissipation (Pe) at Te, using the following formulas:

$$Pe = Pa \times [1-(Te-25^{\circ}C)/100^{\circ}C]$$
, and $Ie = \sqrt{\frac{Pe}{R}}$

Where

 $\label{eq:Ie} Ie = \mbox{Maximum permissible continuous current at elevated} \\ \mbox{temperature } Te$

Pe = Maximum power dissipation at the elevated temperature Te

R = Shunt's resistance (see selection guide for values)

Pa = 0.667 x shunt's rated power at 25°C ambient

Te = Elevated temperature

Example: How much current can a 150 Amp 50mV shunt safely carry at an ambient temperature of $+100^{\circ}$ C?

Te = +100°C

 $Pa = 0.667(150A \times 0.050V) = 5.0 Watts$

 $Pe = 5.0W[1-(100-25)/100] = 5.0W \times (1-0.75) = 1.25W$

R = 0.00033 Ohms

Lastly, use the formula $Ie = \sqrt{\frac{Pe}{R}}$ to find the maximum derated continuous-current at $Te = +100^{\circ}C$:

$$Ie = \sqrt{\frac{1.25W}{0.00033\Omega}} = 61.5A$$

6. Intermittent (Pulsed) Operation: Shunts that will not be exposed to continuous operation at 2/3 rated current can be operated at levels close to, or even above, their nameplate ratings for portions of short periods of times (5 minutes maximum) at 25°C ambient.

The following formulas can be used to calculate the maximum pulsedcurrent (Ipuls) for a given shunt:

$$Ipuls = \sqrt{Ppuls/R}, \text{ and } Ppuls = Pa/K1, \text{ and } K1 = \sqrt{D}$$
 Where

Ipuls = Maximum pulsed current

Ppuls = Maximum pulsed power

Pa = 0.667 x shunt's rated power at 25°C ambient

D = Ratio of ON TIME to ON TIME + OFF TIME (period not to exceed 5 minutes)

K1 = Pulsed-operation rating factor (the square root of D)

R = Shunt's resistance (see selection guide for values)

Example: An 800 Amp 50mV shunt will be operated for 15 seconds each minute. What is the maximum current this shunt can carry during the 15-second ON time?

$$D = 15/60 = 0.25$$
 and $K1 = \sqrt{0.25} = 0.5$

 $Pa = 0.667 (800A \times 0.050V) = 26.7 Watts$

Ppuls = Pa/K1 = 26.7W/0.5 = 53.4 Watts

Ipulsed =
$$\sqrt{\frac{53.4W}{0.0000625\Omega}}$$
 = 924A

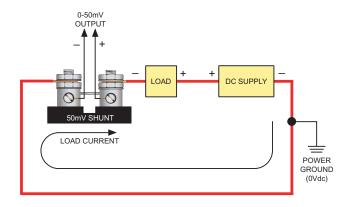


Figure 2. Typical Low-Side Shunt Connections

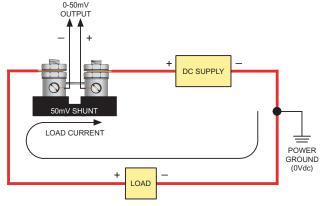


Figure 3. Typical High-Side Shunt Connections






50mV and 100mV Base-mounted DC Shunts

MECHANICAL SPECIFICATIONS


5 through 150 Amps					
Part No.	Rated Current/Output	Resistance (Ωs at 25°C)	Torque Range		
3020-01097-0	5A/50mV	0.01	36-40 in-lbs (4.1-4.5Nm)		
3020-01107-0	10A/100mV	0.01	36-40 in-lbs (4.1-4.5Nm)		
3020-01098-0	20A/50mV	0.0025	36-40 in-lbs (4.1-4.5Nm)		
3020-01096-0	50A/50mV	0.001	36-40 in-lbs (4.1-4.5Nm)		
3020-01099-0	100A/50mV	0.0005	36-40 in-lbs (4.1-4.5Nm)		
3020-01108-0	100A/100mV	0.001	36-40 in-lbs (4.1-4.5Nm)		
3020-01100-0	150A/50mV	0.00033	36-40 in-lbs (4.1-4.5Nm)		

8-32 Kelvin output screws (all shunts): 14-15 in-lbs (1.58-1.69Nm)

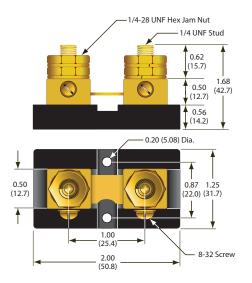

200 through 500 Amps					
Part No.	Rated Current/Output	Resistance (Ωs at 25°C)	Torque Range		
3020-01101-0	200A/50mV	0.00025	14-15 ft-lbs (19.0-20.3Nm)		
3020-01102-0	300A/50mV	0.000167	14-15 ft-lbs (19.0-20.3Nm)		
3020-01103-0	500A/50mV	0.0001	14-15 ft-lbs (19.0-20.3Nm)		

8-32 Kelvin output screws (all shunts): 14-15 in-lbs (1.58-1.69Nm)

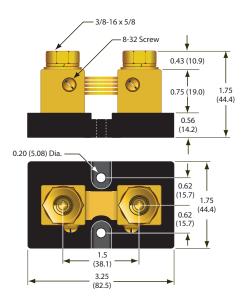




DMS Accessories

50mV and 100mV Base-mounted DC Shunts

MECHANICAL SPECIFICATIONS (continued)

800 through 1200 Amps					
Part No.	Rated Current/Output	Resistance (Ωs at 25°C)	Torque Range		
3020-01104-0	800A/50mV	0.0000625	32-35 ft-lbs (34.4-47.5Nm)		
3020-01105-0	1000A/50mV	0.00005	32-35 ft-lbs (34.4-47.5Nm)		
3020-01106-0	1200A/50mV	0.0000417	32-35 ft-lbs (34.4-47.5Nm)		

8-32 Kelvin output screws (all shunts): 14-15 in-lbs (1.58-1.69Nm)

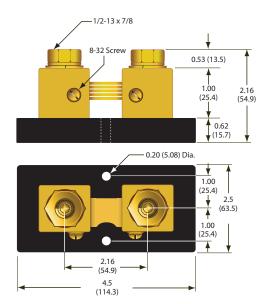

Murata Power Solutions, Inc.
11 Cabot Boulevard, Mansfield, MA 02048-1151 U.S.A. ISO 9001 and 14001 REGISTERED

Murata Power Solutions, Inc. makes no representation that the use of its products in the circuits described herein, or the use of other technical information contained herein, will not infringe upon existing or future patent rights. The descriptions contained herein do not imply the granting of licenses to make, use, or sell equipment constructed in accordance therewith. Specifications are subject to change without notice.





ооо «ниокрсистемс» - это оперативные поставки широкого спектра электронных компонентов отечественного и импортного производства напрямую от производителей и с крупнейших мировых складов. Реализуемая нашей компанией продукция насчитывает более полумиллиона наименований.

Благодаря этому наша компания предлагает к поставке практически не ограниченный ассортимент компонентов как оптовыми, мелкооптовыми партиями, так и в розницу.

Благодаря развитой сети поставщиков, помогаем в поиске и приобретении экзотичных или снятых с производства компонентов.

Наша компания это:

• Гарантия качества поставляемой продукции

Телефон: 8 (495) 268-14-82

Email: n@nsistems.ru

ИНН: 7735154786 ОГРН: 1167746717709

- Широкий ассортимент
- Минимальные сроки поставок
- Техническая поддержка
- Подбор комплектации
- Индивидуальный подход
- Гибкое ценообразование
- Работаем по 275 Ф3